# **HOME REPORT**

#### **GLENHEAD OF COACHFORD CAIRNIE**

**HUNTLY AB54 4TU** 



# ENERGY PERFORMANCE CERTIFICATE



# **Energy Performance Certificate (EPC)**

**Dwellings** 

# **Scotland**

#### **GLENHEAD OF COACHFORD, CAIRNIE, HUNTLY, AB54 4TU**

Dwelling type: Detached bungalow
Date of assessment: 23 September 2024
Date of certificate: 29 October 2024

Total floor area: 228 m<sup>2</sup>

Primary Energy Indicator: 169 kWh/m²/year

**Reference number:** 5600-6875-0322-0126-1143 **Type of assessment:** RdSAP, existing dwelling

**Approved Organisation:** Elmhurst


Main heating and fuel: Boiler and radiators, oil

#### You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO<sub>2</sub> emissions by improving your home

Estimated energy costs for your home for 3 years*	£7,461	See your recommendations
Over 3 years you could save*	£	report for more information

\* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

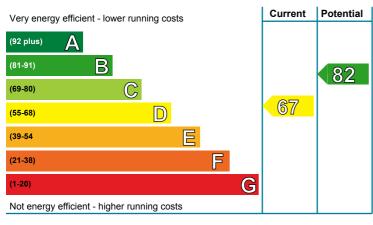


#### **Energy Efficiency Rating**

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band D (67)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

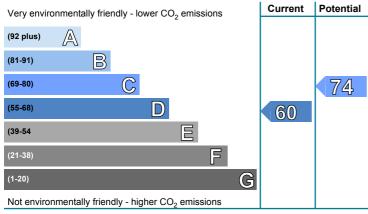

#### **Environmental Impact (CO<sub>2</sub>) Rating**

This graph shows the effect of your home on the environment in terms of carbon dioxide  $(CO_2)$  emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band D (60)**. The average rating for EPCs in Scotland is **band D (59)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

#### Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Solar photovoltaic (PV) panels	£3,500 - £5,500	£1164.00
2 Wind turbine	£15,000 - £25,000	£3075.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

#### Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Solid brick, as built, insulated (assumed) Granite or whinstone, as built, insulated (assumed)	**** ****	**** ****
	Timber frame, as built, insulated (assumed)	****	<b>★★★★</b> ☆
Roof	Pitched, 300 mm loft insulation Pitched, insulated (assumed)	**** ****	**** ****
Floor	Solid, insulated (assumed)	_	_
Windows	Fully double glazed	****	<b>★★★</b> ☆
Main heating	Boiler and radiators, oil Boiler and underfloor heating, oil	**** ***	**** ***
Main heating controls	Programmer, room thermostat and TRVs Time and temperature zone control	**** ****	**** ****
Secondary heating	Room heaters, dual fuel (mineral and wood)	_	_
Hot water	From main system, plus solar	****	<b>★★★</b> ☆
Lighting	Low energy lighting in all fixed outlets	****	****

## The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO<sub>2</sub> emissions, running costs and the savings possible from making improvements.

#### The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 43 kg  $CO_2/m^2/yr$ .

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 9.8 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 2.6 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.

#### Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£6,522 over 3 years	£6,522 over 3 years	
Hot water	£435 over 3 years	£435 over 3 years	You could
Lighting	£504 over 3 years	£504 over 3 years	save £
Totals	£7,461	£7,461	over 3 years

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

#### **Recommendations for improvement**

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

D	and the second s	Indiantive and	Typical saving	Rating after i	mprovement
Re	ecommended measures	Indicative cost	per year	Energy	Environment
1	Solar photovoltaic panels, 2.5 kWp	£3,500 - £5,500	£388	C 72	D 64
2	Wind turbine	£15,000 - £25,000	£1025	B 82	C 74

#### Choosing the right improvement package



For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to www.greenerscotland.org.

#### About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

#### 1 Solar photovoltaic (PV) panels

A solar PV system is one which converts light directly into electricity via panels placed on the roof with no waste and no emissions. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for solar photovoltaic panels, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

#### 2 Wind turbine

A wind turbine provides electricity from wind energy. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Wind turbines are not suitable for all properties. The system's effectiveness depends on local wind speeds and the presence of nearby obstructions, and a site survey should be undertaken by an accredited installer. Planning permission might be required and building regulations generally apply to this work and a building warrant may be required, so it is best to check these with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for a wind turbine, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

#### Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

#### LZC energy sources present:

Solar water heating

#### Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit https://energysavingtrust.org.uk/energy-at-home for more information.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	26,247	N/A	N/A	N/A
Water heating (kWh per year)	3,018			

#### **About this document**

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Mr. Blair Stephen Assessor's name:

Assessor membership number: EES/028024

D M Hall Chartered Surveyors LLP Company name/trading name:

64 Market Place Address: Aberdeenshire Inverurie

**AB51 3XN** 0131 477 6000 Phone number: dmhall@dmhall.co.uk Email address: Related party disclosure: No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

#### Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

#### Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

HOMEENERGYSCOTLAND.ORG
0808 808 2282
FUNDED BY THE SCOTTISH GOVERNMENT



# SINGLE SURVEY



# survey report on:

GLENHEAD OF COACHFORD, CAIRNIE, HUNTLY, AB54 4TU
Mr Gordon Kidd and Mrs Pauline Kidd
Glenhead of Coachford, Cairnie, Huntly, AB54 4TU
DM Hall LLP
23rd September 2024



#### **PART 1 - GENERAL**

#### 1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property<sup>1</sup>.

If the Surveyors have had a previous business relationship within the past two years with the Seller or Seller's Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

#### 1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

Prior to 1 December 2008, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

<sup>&</sup>lt;sup>1</sup> Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Codes of Conduct.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

#### 1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to:

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether
  or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

#### 1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

#### 1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information contained in the Report and the generic Mortgage Valuation Report.<sup>2</sup>

#### 1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless

<sup>&</sup>lt;sup>2</sup> Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct

they assign the same to any other party in writing.

#### 1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

#### 1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the Surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an invoice equivalent to 80% of the agreed fee.

#### 1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

#### 1.1 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format;
- the "Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;

- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller:
- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

#### PART 2 - DESCRIPTION OF THE REPORT

#### 2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

#### 2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

#### 2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the Report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

- 1 Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
- 2 Category 2: Repairs or replacement requiring future attention, but estimates are still advised.
- 3 Category 1: No immediate action or repair is needed.

**WARNING:** If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

#### 2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

#### 2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

#### 2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

#### 2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein

the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

#### 1. Information and scope of inspection

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc. will not be inspected or reported on.

The property is a detached single-storey cottage.  The seller has advised that the site extends to approximately 36 acres, with the Arachie Burn running through the site.
Ground Floor:- Entrance Vestibule, Inner Hall, Bathroom, Cloakroom with WC, Living Room, Dining Room/Sitting Room, Kitchen, Utility Room, Main Bedroom with en-suite Shower Room, Second Bedroom with en-suite Shower Room, and two further Bedrooms.
Approximately 228sqm.
The property is located within an isolated rural setting, within the area of Cairnie. A limited range of facilities and amenities are available within the immediate area, however, a wide range are available within the nearby towns of Keith and Huntly.
Originally built around 1900, having been substantially extended and altered to form the current layout.
Overcast and raining, following a period of mixed weather.
Visually inspected with the aid of binoculars where appropriate.  The chimney stacks appear to be of a mixed stonework and concrete blockwork construction, rendered externally with metal flashings.

#### Roofing including roof space Sloping roofs were visually inspected with the aid of binoculars where appropriate. Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property. If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so. The roof is of a pitched timber construction, comprising timber roof trusses overlaid with timber board sarking, and externally clad with slates. The ridge is tiled whilst valleys are formed in metal. Access to the roof spaces was possible from hatch access points with the Main Bedroom, the Inner Hallway, and the Vestibule. Insulation has been laid between the ceiling joists. Rainwater fittings Visually inspected with the aid of binoculars where appropriate. The rainwater conductors are of a PVC round and half-round construction. Main walls Visually inspected with the aid of binoculars where appropriate. Foundations and concealed parts were not exposed or inspected. The main walls of the original cottage are of a solid stonework construction, rendered externally. The walls to the extensions are rendered externally and appear to be of mixed construction, being of both solid concrete blockwork and traditional cavity timber frame with an outer leaf of concrete blockwork. Windows, external doors and joinery Internal and external doors were opened and closed where keys were available. Random windows were opened and closed where possible. Doors and windows were not forced open. The windows are of a double-glazed timber type. A double-glazed timber Velux window has been incorporated within the Bathroom. The entrance doors are of a timber construction, incorporating double-glazed inserts. There are timber framed French doors leading from the Kitchen to the garden.

External decorations	Visually inspected.
	Low maintenance uPVC. External timbers have been painted or stained as necessary.
Conservatories / porches	Visually inspected.
•	There are no conservatories or porches.
Communal areas	Circulation areas visually inspected.
	There are no communal areas.
Garages and permanent outbuildings	Visually inspected.
	There is a detached outbuilding of mixed concrete and blockwork construction, under a profile metal sheet roof. The outbuilding has been subdivided including a cattle court, storage areas, sileage barn, lined out attic room, and a fully lined out studio which incorporates a cloakroom with WC.
	There is a boiler room/workshop attached to the property, which is accessed via a pedestrian door to the rear.
Outside areas and boundaries	Visually inspected.
	The seller has advised that the site extends to approximately 36 acres, with the land of mixed use including woodland and grass
	paddocks. The Arachie Burn runs through the site.
Ceilings	paddocks. The Arachie Burn runs through the site.  Boundaries are generally defined by post and wire fencing, whilst
Ceilings	paddocks. The Arachie Burn runs through the site.  Boundaries are generally defined by post and wire fencing, whilst the garden incorporates a number of retaining walls.
	paddocks. The Arachie Burn runs through the site.  Boundaries are generally defined by post and wire fencing, whilst the garden incorporates a number of retaining walls.  Visually inspected from floor level.  Ceilings are of suspended plasterboard.
Ceilings Internal walls	paddocks. The Arachie Burn runs through the site.  Boundaries are generally defined by post and wire fencing, whilst the garden incorporates a number of retaining walls.  Visually inspected from floor level.  Ceilings are of suspended plasterboard.  Visually inspected from floor level.
	paddocks. The Arachie Burn runs through the site.  Boundaries are generally defined by post and wire fencing, whilst the garden incorporates a number of retaining walls.  Visually inspected from floor level.  Ceilings are of suspended plasterboard.
	paddocks. The Arachie Burn runs through the site.  Boundaries are generally defined by post and wire fencing, whilst the garden incorporates a number of retaining walls.  Visually inspected from floor level.  Ceilings are of suspended plasterboard.  Visually inspected from floor level.  Using a moisture meter, walls were randomly tested for
Internal walls	paddocks. The Arachie Burn runs through the site.  Boundaries are generally defined by post and wire fencing, whilst the garden incorporates a number of retaining walls.  Visually inspected from floor level.  Ceilings are of suspended plasterboard.  Visually inspected from floor level.  Using a moisture meter, walls were randomly tested for dampness where considered appropriate.  Internal walls are of a timber stud design, lined with plasterboard.
	paddocks. The Arachie Burn runs through the site.  Boundaries are generally defined by post and wire fencing, whilst the garden incorporates a number of retaining walls.  Visually inspected from floor level.  Ceilings are of suspended plasterboard.  Visually inspected from floor level.  Using a moisture meter, walls were randomly tested for dampness where considered appropriate.

Internal joinery and kitchen fittings	Built-in cupboards were looked into but no stored items were moved.
	Kitchen units were visually inspected excluding appliances.
	The Kitchen and Utility Rooms have been fitted with a range of floor and wall mounted units.
	Internal doors and joinery are generally of a timber construction.
Chimney breasts and fireplaces	Visually inspected.
	No testing of the flues or fittings was carried out.
	There is a chimney breast to the Dining Room/Sitting Room with exposed stonework and having been fitted with a wood burning stove.
	A further wood burning stove has been fitted to the living room.
Internal decorations	Visually inspected.
internal decorations	
	Internal walls and ceilings are generally painted. Tiling has been incorporated within the Kitchen, Utility Room, Bathroom, and both Shower Rooms.
Callana	
Cellars	Visually inspected where there was a safe and purpose-built access.
	There are no cellars.
Electricity	Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.
	The property is connected to the mains electricity supply. Visible wiring appears to be of PVC coated cabling incorporating 13amp socket outlets. The meter and consumer unit are located within a high-level cupboard in the Kitchen.
Gas	Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.  There is no mains gas. However, there is a bottled gas supply for the Kitchen hob.

#### Water, plumbing, bathroom fittings

Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.

No tests whatsoever were carried out to the system or appliances.

The seller has advised that the property is served by a private water supply, the overflow of which supplies 3 other properties. Visible plumbing appears to of copper and PVC materials.

The Bathroom comprises WC, wash hand basin, panelled bath, and shower cabinet with overhead mixer shower.

The Shower Rooms each comprise WC, wash hand basin, and shower cabinet with overhead mixer shower.

The Kitchen and Utility Rooms incorporate stainless steel sink units.

#### Heating and hot water

Accessible parts of the system were visually inspected apart from communal systems, which were not inspected.

No tests whatsoever were carried out to the system or appliances.

The property is centrally heated by a ground-mounted oil-fired 'Grant Vortex Pro Utility System 36- 46S' boiler connected to a series of steel-panelled radiators equipped with thermostatic radiator valves. Domestic hot water is provided by the central heating boiler which is located within the boiler room to the side. A pre-insulated hot water cylinder has an electric immersion heater fitted.

There is underfloor heating to the Kitchen, Utility Room, and two Bedrooms.

There is a solar water heating panel to the rear roof pitch.

#### Drainage

Drainage covers etc were not lifted.

Neither drains nor drainage systems were tested.

The seller has advised that foul water drainage is to a private septic tank, which is located within the site.

#### Fire, smoke and burglar alarms

Visually inspected.

No tests whatsoever were carried out to the system or appliances.

A smoke detection system has been fitted.

Legislation by the Scottish Government, which took effect from February 2022, requires all residential properties to have a system of inter-linked smoke alarms and heat detectors. Carbon monoxide detectors are also required where appropriate. Purchasers should appraise themselves of the requirements of this legislation, and engage with appropriately accredited contractors to ensure compliance.

#### Any additional limits to inspection

At the time of my inspection the property was occupied, fully furnished, and all floors covered. My inspection of the roof spaces was restricted by the presence of insulation materials and to head and shoulders inspections only of the areas visible from the ceiling hatches in the Main Bedroom, Inner Hall, and Vestibule. No inspection was possible of any subfloor areas.

In accordance with Health and Safety guidelines I have not disturbed insulation, furniture or personal effects (particularly in cupboards). Floor coverings have not been moved.

Random testing for dampness was undertaken internally with the use of a moisture meter where accessible and considered appropriate.

Parts of the property, which are covered, unexposed or inaccessible, cannot be guaranteed to be free from defect.

I have not carried out an inspection for Japanese Knotweed and unless otherwise stated, for the purposes of the valuation I have assumed that there is no Japanese Knotweed or other invasive plants within the boundaries of the property or in neighbouring properties.

#### Sectional Diagram showing elements of a typical house



Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

- 1) Chimney pots
- 2) Coping stone
- 3) Chimney head
- 4 Flashing
- 5 Ridge ventilation
- 6 Ridge board
- 7) Slates / tiles
- 8 Valley guttering
- 9 Dormer projection
- 10) Dormer flashing
- 11) Dormer cheeks
- 12) Sarking
- 13) Roof felt
- (14) Trusses
- (15) Collar
- 16 Insulation
- (17) Parapet gutter
- 18) Eaves guttering
- (19) Rainwater downpipe
- 20) Verge boards/skews
- 21) Soffit boards
- 22) Partition wall
- 23) Lath / plaster
- (24) Chimney breast
- (25) Window pointing
- 6) Window sills
- 27) Rendering
- (28) Brickwork / pointing
- 29) Bay window projection
- 30 Lintels
- (31) Cavity walls / wall ties
- 32) Subfloor ventilator
- (33) Damp proof course
- 34) Base course
- (35) Foundations
- 36) Solum
- (37) Floor joists
- (38) Floorboards
- 39) Water tank
- 40 Hot water tank

#### 2. Condition

This section identifies problems and tells you about the urgency of any repairs by using one of the following three categories:

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Structural movement	
Repair category	1
Notes	The property has been affected by previous movement but within the limitations of the inspection there was no evidence to suggest that this is ongoing.

Dampness, rot and infestation	
Repair category	1
Notes	There is evidence of mice within the roof voids.

Chimney stacks	
Repair category	1
Notes	No significant defects evident.

Roofing including roof space	
Repair category	1
Notes	No significant defects evident.  Natural slates have an expected lifespan of up to 100 years or more depending on slate quality, source, thickness and cutting skill of the slate. Slates will deteriorate over time; nail fixings will corrode and loosen resulting in on-going maintenance requirements. Close quarter and disruptive inspections may reveal damage to roofing materials, especially where these are original. Regular maintenance should be anticipated particularly after adverse weather conditions.

Rainwater fittings	
Repair category	1
Notes	No significant defects evident.

Main walls	
Repair category	1
Notes	No significant defects evident.

Windows, external doors and joinery	
Repair category	1
Notes	No significant defects evident.
	Regular repainting of the windows will be required to maintain an attractive appearance and to prevent deterioration of external timbers.
	Random windows and doors are opened but not all and inspections can be restricted by window blinds, curtains, ornaments etc. Handles, locks and opening mechanisms can deteriorate through usage and repair or replacement can be anticipated on an ad hoc basis. No assurances can be provided that all window fitments are functional.

External decorations	
Repair category	1
Notes	Regular repainting is required to maintain an attractive appearance and to prevent deterioration of external timbers.

Conservatories/porches	
Repair category	-
Notes	There are no conservatories or porches.

Communal areas	
Repair category	-
Notes	There are no communal areas.

Garages and permanent outbuildings	
Repair category	2
Notes	The outbuildings are showing a range of age related defects, which are consistent with their age and type of construction, including for example water ingress, damaged external pointing, older electrical fitments, and deterioration to some timbers. A builder could inspect the entirety of the outbuildings and provide further advice as to any necessary repairs and upgrades that may be required.

Outside areas and boundaries	
Repair category	1
Notes	The full extent of the feu, including all rights of access, could be ascertained with reference to the title deeds.
	There are mature trees growing within influencing distance of the property and the outbuildings. A tree surgeon will be able to provide further advice.
	Some areas of garden are stepped and incorporate retaining walls, these should be monitored on an ongoing basis.

Ceilings	
Repair category	1
Notes	No significant defects evident.

Internal walls	
Repair category	1
Notes	No significant defects evident.

Floors including sub-floors	
Repair category	1
Notes	No significant defects evident.  It is not unusual to discover areas of past water spillage when floor coverings are removed in kitchen and bathroom compartments, revealing the need for further repair and maintenance work.

Internal joinery and kitchen fittings	
Repair category	1
Notes	Internal joinery and kitchen fittings have been subjected to wear and tear commensurate with usage.

Chimney breasts and fireplaces	
Repair category	1
Notes	Solid fuel stoves have been installed. It is assumed that these installations comply with the Building Standards.

Internal decorations	
Repair category	1
Notes	No significant defects evident.

Cellars	
Repair category	-
Notes	There are no cellars.

Electricity	
Repair category	1
Notes	No significant defects evident.  It is recommended that all electrical installations be checked every five years or on change of ownership to keep up to date with frequent changes in Safety Regulations. Further advice will be available from a qualified NICEIC/SELECT registered Contractor. It should be appreciated that only recently constructed or rewired properties will have installations which fully comply with IET regulations.

Gas	
Repair category	1
Notes	There is no mains gas, however, there is a bottled gas supply.  Trade bodies governing gas installations currently advise that gas appliances should be tested prior to change in occupancy and thereafter at least once a year by a Gas Safe registered contractor. It is assumed that gas appliances comply with relevant regulations.

Water, plumbing and bathroom fittings	
Repair category	1
Notes	The property is served by a shared private water supply and it is not possible to comment on legal issues or the quality of quantity of the supply, and for the purposes of this report, all are assumed to be satisfactory.

Heating and hot water	
Repair category	1
Notes	It is assumed that the heating and hot water systems have been properly serviced and maintained on a regular basis and installed in accordance with the relevant regulations.  Boilers and central heating systems should be tested and serviced by an Oftec oil registered engineer on an annual basis to ensure their safe and efficient operation.

Drainage	
Repair category	1
Notes	The septic tank has not been inspected, and condition, legal, and environmental issues have not been investigated. For the purposes of this report, all are assumed to be satisfactory.

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the previous comments for detailed information.

Structural movement	1
Dampness, rot and infestation	1
Chimney stacks	1
Roofing including roof space	1
Rainwater fittings	1
Main walls	1
Windows, external doors and joinery	1
External decorations	1
Conservatories/porches	-
Communal areas	-
Garages and permanent outbuildings	2
Outside areas and boundaries	1
Ceilings	1
Internal walls	1
Floors including sub-floors	1
Internal joinery and kitchen fittings	1
Chimney breasts and fireplaces	1
Internal decorations	1
Cellars	-
Electricity	1
Gas	1
Water, plumbing and bathroom fittings	1
Heating and hot water	1
Drainage	1

#### Category 3

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

#### Category 2

Repairs or replacement requiring future attention, but estimates are still advised.

#### Category 1

No immediate action or repair is needed.

#### Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

#### Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

#### 3. Accessibility information

#### Guidance notes on accessibility information

Three steps or fewer to a main entrance door of the property:

In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres:

For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

1. Which floor(s) is the living accommodation on?	Ground
2. Are there three steps or fewer to a main entrance door of the property?	Yes X No
3. Is there a lift to the main entrance door of the property?	Yes No X
4. Are all door openings greater than 750mm?	Yes X No
5. Is there a toilet on the same level as the living room and kitchen?	Yes X No
6. Is there a toilet on the same level as a bedroom?	Yes X No
7. Are all rooms on the same level with no internal steps or stairs?	Yes X No
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes X No

#### 4. Valuation and conveyancer issues

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

#### Matters for a solicitor or licensed conveyancer

The seller has advised that the site extends to approximately 36 acres. The full extent of the feu, including all rights of access and the full extent of the site, could be ascertained with reference to the title deeds.

The property has been substantially altered and extended since its original construction. We have assumed all necessary Local Authority and other consents have been obtained for alterations and the appropriate documentation, including Building Warrants and Completion Certificates issued. If any works did not require consent then we have assumed they meet the standards required by the Building Regulations or are exempt.

Drainage is to a septic tank. It is assumed that the tank is registered with SEPA. The position regarding age, location, condition and maintenance history should be clarified.

The property is served by a shared private water supply. It is not possible to comment on legal issues or the quality of quantity of the supply, and for the purposes of this report, all are assumed to be satisfactory.

Access serving the property is gained over a private unmade access road from the nearest publicly maintained road. It is assumed that all appropriate rights of access are contained within the titles. Any maintenance liabilities should be established.

The seller has advised that there is planning consent for the erection of a steel shed and polytunnel under APP/2024/0107.

#### Estimated reinstatement cost for insurance purposes

£835,000 (EIGHT HUNDRED AND THIRTY FIVE THOUSAND POUNDS).

It should be noted this sum is an estimate calculated by using a rate per square metre based on information provided by Building Cost Information Service (BCIS).

The reinstatement value given is exclusive of outbuildings as their reinstatement cost will be far in excess of their present value. You are therefore advised to contact your own insurers to agree an appropriate replacement cost for the buildings.

#### Valuation and market comments

Market value with vacant possession:- £560,000 (FIVE HUNDRED AND SIXTY THOUSAND POUNDS).

Against a backdrop of changing economic circumstances and increasing interest rates, it is not possible to predict how the market will perform in the coming months although market conditions continue to be stable at present.

Signed	Security Print Code [538814 = 5489 ] Electronically signed
Report author	Blair Stephen
Company name	DM Hall LLP

Address	64 Market Place, Inverurie, AB51 3XN
Data of voyant	
Date of report	28th October 2024

# Mortgage Valuation Report



Address GLENHEAD OF COACHFORD, CAIRNIE, HUNTLY, AB54 4TU Seller's Name Mr Gordon Kidd and Mrs Pauline Kidd Date of Inspection 23rd September 2024		
House X Bungalow Chalet Purpose built maisonette Coach Studio Converted maisonette Purpose built flat Converted flat Flat over non-residential use Other (specify in General Remarks)		
X       Detached       Semi detached       Mid terrace       End terrace         Back to back       High rise block       Low rise block       Other (specify in General Remarks)		
Does the surveyor believe that the property was built for the public sector,  e.g. local authority, military, police?		
ly Floor(s) on which located No. of floors in block Lift provided? Yes No. of units in block		
Construction 1900		
Leasehold Ground rent £ Unexpired years		
2 Living room(s) 4 Bedroom(s) 1 Kitchen(s) 3 Bathroom(s) 4 WC(s) 1 Other (Specify in General remarks)		
cluding garages and outbuildings) 228 m² (Internal) 277 m² (External)		
(greater than 40%) X Yes No		
Outbuildings		
□ Double garage       ▼ Parking space         ▼ Yes       No		
ngs:		
rshop. Detached general purpose outbuildings and studio.		
1 (		

# Mortgage Valuation Report

Construction								
Walls	Brick	X Stone	Cor	ncrete	Timber frame			
	Solid	Cavity		el frame	Concrete block	Othe	er (specify in Ger	neral Remarks)
Roof	Tile	X Slate		halt [	Felt		()	,
	Lead	Zinc		ficial slate	Flat glass fibre	Othe	er (specify in Ger	neral Remarks)
	_	<u>—</u>	_	_	-			
Special Risks								
Has the property	suffered struct	tural moveme	ent?				X Yes	No
If Yes, is this rece	ent or progress	sive?					Yes	X No
Is there evidence, immediate vicinity	, history, or rea ?	ason to antic	pate subsi	dence, he	ave, landslip o	or flood in th	e Yes	X No
If Yes to any of th	e above, prov	ide details in	General R	emarks.				
Service Connec	ction							
		If any comit	200 00000	to be non	maina placa	o commont	on the time o	nd location
Based on visual in of the supply in G			es appear	to be non	-mains, pieas	e comment	оп ше туре а	กน เบเลแบท
Drainage	Mains	X Private	None		Water	Mains	X Private	None
Electricity	X Mains	Private	None		Gas	Mains	Private	X None
Central Heating	X Yes	Partial	None					
Brief description of	of Central Hea	ting:						
Oil fired radiator	heating syste	em.						
Site								
Apparent legal iss	sues to be ver	ified by the co	nvevance	r Please r	rovide a brief	description	in General R	omarke
Rights of way	X Shared driv	-	_	-	nities on separate	_	ared service con	
X Agricultural land in	<del></del>		_	d boundaries			er (specify in Ge	
		,						-,
Location								
Residential suburb	Res	sidential within to	own / city	Mixed res	sidential / comme	rcial Mai	inly commercial	
Commuter village	Rer	note village	[	X Isolated r	ural property	Oth	er (specify in Ge	eneral Remarks)
Planning Issues	S							
Has the property	been extende	d / converted	/ altered?	X Yes	No			
If Yes provide det				<del></del>				
Roads								
	V Harran		annelst 1	1	D. d			
Made up road	X Unmade road	ɑ ∐ Partly	completed ne	ew road	Pedestrian a	ccess only	Adopted	Unadopted

## Mortgage Valuation Report

### **General Remarks**

Other accommodation:- Utility Room.

The property is located within an isolated rural setting, within the area of Cairnie. A limited range of facilities and amenities are available within the immediate area, however, a wide range are available within the nearby town of Huntly.

The seller has advised that the site extends to approximately 36 acres. The full extent of the feu, including all rights of access and the full extent of the site, could be ascertained with reference to the title deeds.

The property has been substantially altered and extended since its original construction. We have assumed all necessary Local Authority and other consents have been obtained for alterations and the appropriate documentation, including Building Warrants and Completion Certificates issued. If any works did not require consent then we have assumed they meet the standards required by the Building Regulations or are exempt.

Drainage is to a septic tank. It is assumed that the tank is registered with SEPA. The position regarding age, location, condition and maintenance history should be clarified.

The property is served by a shared private water supply. It is not possible to comment on legal issues or the quality of quantity of the supply, and for the purposes of this report, all are assumed to be satisfactory.

Access serving the property is gained over a private unmade access road from the nearest publicly maintained road. It is assumed that all appropriate rights of access are contained within the titles. Any maintenance liabilities should be established.

The seller has advised that there is planning consent for the erection of a steel shed and polytunnel under APP/2024/0107.

The property has been affected by previous movement but within the limitations of the inspection there was no evidence to suggest that this is ongoing.

The reinstatement value given is exclusive of outbuildings as their reinstatement cost will be far in excess of their present value. You are therefore advised to contact your own insurers to agree an appropriate replacement cost for the buildings.

At the time of inspection the property was found to be in a condition consistent with its age and type of construction.

# None apparent within the limitations of our inspection. | Stimated cost of essential repairs £ N/A | Retention recommended? | Yes | X | No | Amount £ N/A | No | Amou

# Mortgage Valuation Report

Comment on Mortgagea	bility	
Subject to the comments of the property forms suitable	contained within this report, and individual lending requirements, we woul e security for normal mortgage loan purposes.	d confirm that
Valuations		
Market value in present cor Market value on completion Insurance reinstatement va (to include the cost of total it Is a reinspection necessary	n of essential repairs lue rebuilding, site clearance, professional fees, ancillary charges plus VAT)	£ 560,000 £ N/A £ 835,000
Buy To Let Cases		
month Short Assured Tenar Is the property in an area w	ge of monthly rental income for the property assuming a letting on a 6 ncy basis? There there is a steady demand for rented accommodation of this type?	£
Declaration		
Signed Surveyor's name Professional qualifications Company name Address Telephone Fax	Security Print Code [538814 = 5489] Electronically signed by:- Blair Stephen AssocRICS DM Hall LLP 64 Market Place, Inverurie, AB51 3XN 01467 624393	
Report date	28th October 2024	

# PROPERTY QUESTIONNAIRE





# Property Questionnaire

PROPERTY ADDRESS:	Glenhead of Coachford Cairnie HUNTLY AB54 4TU
SELLER(S):	Pauline Kidd Gordon Kidd
COMPLETION DATE OF PROPERTY QUESTIONNAIRE:	

### **PROPERTY QUESTIONNAIRE**

### NOTE FOR SELLERS

- Please complete this form carefully. It is important that your answers are correct.
- The information in your answers will help ensure that the sale of your house goes smoothly. Please answer each question with as much detailed information as you can.
- If anything changes after you fill in this questionnaire but before the Date of Entry for the sale of your house, tell your solicitor or estate agent immediately.

# PROPERTY QUESTIONNAIRE Information to be given to prospective buyer(s)

1.	Length of ownership
	How long have you owned the property?  15y
2.	Council Tax
	Which Council Tax band is your property in?
	ABCDEFGH
3.	Parking
	What are the arrangements for parking at your property?  (Please indicate all that apply)  Garage  Allocated parking space  Driveway  Shared parking  On street  Resident permit  Metered parking  Other (please specify):

4.	Conservation Area	
	Is your property in a designated Conservation Area (i.e. an area of special architectural or historic interest, the character or appearance of which it is desirable to preserve or enhance)?	Yes/No/ Don't know
5.	Listed Buildings	
	Is your property a Listed Building, or contained within one (i.e. a building recognised and approved as being of special architectural or historical interest)?	Yes/No
6.	Alterations / additions / extensions	
a.	(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)?	Yes No
	If you have answered yes, please describe the changes which you have made:	
	Extension of dwelling house.	

	(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work?	Yes
	If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking.	
	If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent can arrange to obtain them.	
b.	Have you had replacement windows, doors, patio doors or double glazing installed in your property?	Yes/No
	If you have answered yes, please answer the three questions below:	
	(i) Were the replacements the same shape and type as the ones you replaced?	YesNo
	(ii) Did this work involve any changes to the window or door openings?	YesNo
	(iii) Please describe the changes made to the windows doors, or patio doors (with approximate dates when the work was completed):	
	All new doors to comply with building warrant access requirements	
	Please give any guarantees which you received for this work to your solicitor or estate agent.	

7.	Central heating	
		VestNe/
a.	Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main rooms of the property – the main living room, the bedroom(s), the hall and the bathroom).  If you have answered yes/partial – what kind of central	Yes No/ Partial
	heating is there?	
	(Examples: gas-fired, solid fuel, electric storage heating, gas warm air.)	
	If you have answered yes, please answer the 3 questions below:	
b.	When was your central heating system or partial central heating system installed?	2012
C.	Do you have a maintenance contract for the central heating system?	Yes No
	If you have answered yes, please give details of the company with which you have a maintenance agreement:	
	Boiler is serviced annually	
d.	When was your maintenance agreement last renewed? (Please provide the month and year).	
	Aug-2024	

8.	Energy Performance	Certificate			
	Does your property Certificate which is le	y have an E ss than 10 year	nergy Performands s old?	ce Yes No	
9.	Issues that may have	affected your p	property		
a.	Has there been any st damage to your prope			YesiNo	
	If you have answered any outstanding insu		nage the subject of	Yes/No	
b.	Are you aware of the existence of asbestos in your property?				
	If you have answered yes, please give details:				
10.	Services				
a.	Please tick which services are connected to your property and give details of the supplier:				
	Services	Connected	Supplier		
	Gas / liquid petroleum gas				
	Water mains / private water supply				
	Electricity		British Gas		

	Mains drainage			
	Wallis Graillage			
	Telephone		ВТ	
	Cable TV / satellite		Freesat	
	Broadband		BT & StarLink	
		4		Vacillo
b.	Is there a septic tank	system at your	property?	Yes No
	If you have answered questions below:	<u>yes,</u> please ans	swer the two	
c.	Do you have appropriate consents for the discharge from your septic tank?			Yes No/ Don't Know

d.	Do you have a maintenance contract for your septic tank?	Ye:/No
	If you have answered yes, please give details of the company with which you have a maintenance contract:	

11.	Responsibilities for Shared or Common Areas	
a.	Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area?  If you have answered yes, please give details:	Yes No
b.	Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas?  If you have answered yes, please give details:	Yes No Not applicable
C.	Has there been any major repair or replacement of any part of the roof during the time you have owned the	Yes No

	property?	
d.	Do you have the right to walk over any of your neighbours' property - for example to put out your rubbish bin or to maintain your boundaries?	Yes/No
	If you have answered yes, please give details:	
	Common access road	
e.	As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries?	Yes/No
	If you have answered yes, please give details:	

f.	As far as you are aware, is there a Public Right of Way across any part of your property? (A Public Right of Way is a way over which the public has a right to pass, whether or not the land is privately-owned.)  If you have answered yes, please give details:	Yes/No
	Old military road runs beside property	
12.	Charges associated with your property	
a.	Is there a factor or property manager for your property?  If you have answered yes, please provide the name and address and give details of any deposit held and approximate charges:	Yes/No

b.	Is there a common buildings insurance policy?	Ye (No Don't know
	If you have answered yes, is the cost of the insurance included in your monthly/annual factor's charges?	Yes/No/ Don't know
C.	Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, e.g. to a Residents' Association, or maintenance or stair fund.	NIL

13.	Specialist Works	
a.	As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property?  If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property	Yes/No
b.	As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your	Yes/No

	property?	
	If you have answered yes, please give details	
C.	If you have answered yes to 13(a) or (b), do you have any guarantees relating to this work?	
	If you have answered yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself please write below who has these documents and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate.	

	Guarantees are held by	:			
14.	Guarantees				
	A 11	4:	- C	. of the e	
a.	Are there any guaranted following:	es or warranti	es for an	y or the	
(i)	Electrical work	No Yes	Don't	With title	Lost
` '			Know	deeds	
(ii)	Roofing	No Yes	Don't	With title	Lost
/:::\	Control booting	No Yes	Know Don't	deeds With title	Lost
(iii)	Central heating	land les	know	deeds	LOST
(iv)	NHBC	No Yes	Don't	With title	Lost
` ′			know	deeds	

(v) (vi)	Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)		Yes	Don't know Don't know	With title deeds With title deeds	
b.	If you have answered 'ye of the work or installation	s' or '	with t	itle deeds the guara	<u>',</u> please giv antee(s) rela	ve details te(s):
C.	Are there any outstandin guarantees listed above?  If you have answered yes	•				Yes(No
15.	Boundaries					

	So far as you are aware, has any boundary of your property been moved in the last 10 years?  If you have answered yes, please give details:	Yes(No) Don't Know
16.	Notices that affect your property	
	In the past 3 years have you ever received a notice:	
a.	advising that the owner of a neighbouring property has made a planning application?	Yes/No Don'τ know
b.	that affects your property in some other way?	Yes/No/ Don't
c.	that requires you to do any maintenance, repairs or improvements to your property?	know Yes/Nc/ Don t know
	If you have answered yes to any of a-c above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchase of your property.	

Declaration by the seller(s)/or other authorised body or person(s):

I / We confirm that the information in this form is true and correct to the best of my/our knowledge and belief.
Signature(s) :



### **ABERDEEN**

aberdeen\_residential@dmhall.co.uk 01224 594172

### **AYR**

ayr@dmhall.co.uk 01292 286974

### **DUMFRIES**

dumfries@dmhall.co.uk 01387 254318

### **DUNDEE**

dundee@dmhall.co.uk 01382 873100

### **DUNFERMLINE**

dunfermline@dmhall.co.uk 01383 621262

### **EDINBURGH**

edinburghresidential@dmhall.co.uk0131 624 6600

### **FLGIN**

elgin@dmhall.co.uk 01343 548501

### **FALKIRK**

falkirk@dmhall.co.uk 01324 628321

### **GALASHIELS**

galashiels@dmhall.co.uk 01896 752009

### **GLASGOW** (Residential)

glasgowresidential@dmhall.co.uk0141 636 4141

### **HAMILTON**

hamilton@dmhall.co.uk 01698 284939

### **INVERNESS**

inverness@dmhall.co.uk 01463 241077

### **INVERURIE**

inverurie@dmhall.co.uk 01467 624393

### **IRVINE**

irvine@dmhall.co.uk 01294 311070

### **KIRKCALDY**

kirkcaldy@dmhall.co.uk 01592 598200

### LIVINGSTON

livingston@dmhall.co.uk 01506 490404

### **OBAN**

oban-admin@dmhall. co.uk 01631 564225

### **PAISLEY**

Enquiries are now dealt with at our Glasgow Hub.

### **PERTH**

perth@dmhall.co.uk 01738 562100

### **PETERHEAD**

peterhead@dmhall.co.uk 01779 470220

### **ST ANDREWS**

standrews@dmhall.co.uk 01334 844826

### **STIRLING**

stirling@dmhall.co.uk 01786 475785

